
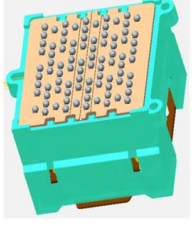
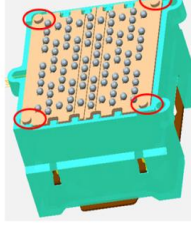
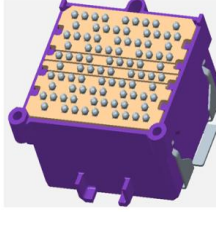


Product/Process Change Notifications

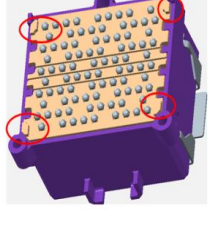

PCN - 15 052

Release Date: June 11 2015

Product Name:	Infinx		
	Infinx 4 Pair Plug and Receptacle		
Product Manager:	Bruce Liu		
Subject:	Notification of Change with Immediate Effectivity		
Distribution:	General		
Type of Change:	Design Change		
Change Description:	<p>Add four stand-offs on the wafer .</p> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Plug change compare</p> <p>Before change</p>  </div> <div style="text-align: center;"> <p>After change</p> <p>Add four standoffs on the wafer</p>  </div> <div style="text-align: center;"> <p>Receptacle change comparison</p> <p>Before change</p>  </div> <div style="text-align: center;"> <p>After change</p> <p>Add four standoffs on the wafer</p>  </div> </div>		
Reason for Change:	<p>In the original design, there are stack-up tolerances between the bottom surface of the wafer and the bottom surface of the stand offs which cause the solder bridge at the customer end. Adding Stand-off's will eliminate assembly stack-up tolerances . It also guarantees that the headroom is always fixed and sufficient to prevent solder balls from bridging to adjacent pads in inverted reflow situations.</p>		
Affected Parts:	Attached list		
Effective Date of Change:	December 15, 2015		
Last Time Buy Date:	NA		
Last Disty Return Date:	NA		
Last Time Shipment Date	NA		
Datasheet Attached?	NA		
Qual/Test Data Attached?	NA		
Samples Availability Date:	June	11	2015
Available Alternatives?	N/A		
Questions?	<i>Contact your local FCI Representative, or Product Manager</i>		
	<i>Bruce Liu / Product Manager</i>		
	<i>Bruce.Liu@fci.com</i>		

Note:

Customer shall intimate the product Manager any Concern regarding the PCN within 3 weeks of the release date. PCN is considered approved by the customer if no communication is received within 3 weeks